UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF SAFETY AND ENVIRONMENTAL ENFORCEMENT GULF OF MEXICO REGION -

ACCIDENT INVESTIGATION REPORT

For Public Release

L.	OCCURRED	
	DATE:	STRUCTURAL DAMAGE
	27-MAY-2015 TIME: 0530 HOURS	CRANE
		OTHER LIFTING DEVICE
2.	OPERATOR: Arena Offshore, LP	DAMAGED/DISABLED SAFETY SYS.
	REPRESENTATIVE:	INCIDENT >\$25K
	TELEPHONE:	H2S/15MIN./20PPM
	CONTRACTOR: Hercules Offshore, Inc	REQUIRED MUSTER
	REPRESENTATIVE:	SHUTDOWN FROM GAS RELEASE
	TELEPHONE:	HOTHER
3.	OPERATOR/CONTRACTOR REPRESENTATIVE/SUPERVISOR ON SITE AT TIME OF INCIDENT:	6. OPERATION:
		☐ PRODUCTION
		X DRILLING
ł.	LEASE: G02705	WORKOVER
	AREA: HI LATITUDE:	COMPLETION
	BLOCK: A 547 LONGITUDE: -	HELICOPTER
		MOTOR VESSEL
5.	PLATFORM: - C	PIPELINE SEGMENT NO.
	RIG NAME: HERCULES 300	OTHER
5.	ACTIVITY: EXPLORATION (POE)	8. CAUSE:
	X DEVELOPMENT/PRODUCTION	□
	(DOCD/POD)	X EQUIPMENT FAILURE X HUMAN ERROR
7.	TYPE:	EXTERNAL DAMAGE -
	HISTORIC INJURY-	SLIP/TRIP/FALL-
	REQUIRED EVACUATION 1-	WEATHER RELATED
	LTA (1-3 days)	H LEAK
		UPSET H20 TREATING
	RW/JT (1-3 days)	OVERBOARD DRILLING FLUID
	RW/JT (>3 days)	OTHER
	Other Injury-	
		9. WATER DEPTH: 253 FT.
	FATALITY	
	POLLUTION	10. DISTANCE FROM SHORE: 101 MI.
	FIRE	
	L EXPLOSION	11. WIND DIRECTION: SE-
	LWC- HISTORIC BLOWOUT	SPEED: 23 M.P.H.
	UNDERGROUND	
	SURFACE	12. CURRENT DIRECTION: SE
	DEVERTER	
	SURFACE EQUIPMENT FAILURE OR PROCEDURES	SPEED: 5 M.P.H.
	COLLISION HISTORIC >\$25K <=\$25K	13. SEA STATE: 7 FT.
		· · · · · · · · · · · · · · · ·

MMS - FORM 2010 - PAGE: 1 OF 3 -

The drill crew was laying down 5 inch drill pipe utilizing an air hoist and single joint elevators. The Injured Person (IP) had latched and pinned the single joint elevators to a joint of pipe in the mouse hole. As the joint of pipe cleared the mouse hole the IP pushed it out the v-door. The top part of the drill pipe and the single joint elevators struck an "A"-frame bumper at the top of the v-door. Immediately the elevators became unlatched and the joint of pipe fell approximately 25 to 30 feet striking the Floor Man on the left frontal portion of his hardhat. This occurrence knocked the Floor Man to the rig floor where he laid unconscious for a few seconds. Other drill crew personnel rendered assistance to the IP until Medical help arrived on the rig floor. IP was evacuated by helicopter to University of Texas Medical Branch (UTMB) Hospital in Galveston, Texas, for further evaluation and treatment.

18. LIST THE PROBABLE CAUSE(S) OF ACCIDENT:

The safety pin of the single joint elevators came out from it's normal position and did not prevent the latch from coming open when the elevators impacted the "A"-frame bumper.

19. LIST THE CONTRIBUTING CAUSE(S) OF ACCIDENT:

Single joint elevators were not maintained as per manufacturer's specifications at the time of the incident. A long piece of wire was being utilized to hold the pin to the body of the single joint elevators instead of the original piece of chain.

20. LIST THE ADDITIONAL INFORMATION:

None

21. PROPERTY DAMAGED:

NATURE OF DAMAGE:

None None

ESTIMATED AMOUNT (TOTAL):

Ġ

22. RECOMMENDATIONS TO PREVENT RECURRANCE NARRATIVE:

The Lake Jackson District Office does not have any recommendations to the regional office at this time.

- 23. POSSIBLE OCS VIOLATIONS RELATED TO ACCIDENT: YES
- 24. SPECIFY VIOLATIONS DIRECTLY OR INDIRECTLY CONTRIBUTING. NARRATIVE:

Lessee failed to maintain equipment as per manufacturer's specifications. Original Equipment Manufacturers (OEM) show a small length of chain attached from the body

MMS - FORM 2010 PAGE: 2 OF 3 -

EV2010R 18-AUG-2015-

For Public Release

of the single joint elevators to the pin. Job Safety Analysis (JSA) failed to identify or mitigate the potential hazard of the pin coming out of the elevators. JSA failed to identify the hazard of the elevators striking the "A"-frame bumper orways to mitigate the drill pipe from striking the "A"-frame bumper. -

25. DATE OF ONSITE INVESTIGATION:

27-MAY-2015

26. ONSITE TEAM MEMBERS:

James Holmes / Daniel Gonzalez / David Kearns /

29. ACCIDENT INVESTIGATION PANEL FORMED: NO

OCS REPORT:

30. DISTRICT SUPERVISOR:

John McCarroll

APPROVED

DATE: 18-AUG-2015

MMS - FORM 2010 PAGE: 3 OF 3 -

EV2010R 18-AUG-2015-